

Installation guide


- 1 Unpack the product and check that all components are present.



Pre-cut cord of a specific length for each rod



Height adjustment comb



Brackets with rollers



x6

Bracket mounting kit
• Universal screw 4.0x50
• Expansion dowel 8.0x50




x2

Comb mounting kit
• Universal screw 3.5x35
• Expansion dowel 6.0x35



x8

Fixation cap for height adjustment

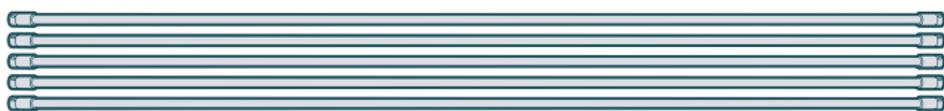


Measuring rod

- 2 The **brackets with rollers** must be fixed to the ceiling using screws. The distance between the **brackets** should correspond to the length (L) of the **measuring rods**, minus 18-20 mm for the central hole of the mounting structure.

To install:


1. Measure and mark two parallel lines on the ceiling (the distance between them depends on the size of the drying rack).
2. Position the brackets with rollers along these lines and mark the drilling points.
3. Drill holes and secure the brackets using the bracket mounting kit.

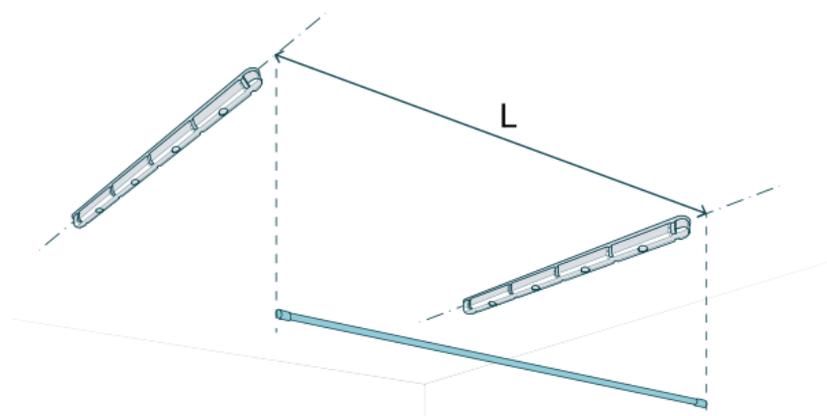


- 3 Determine the optimal personal height for installing the **height adjustment comb** (recommended height: 1.3–1.6 meters from the floor) by lifting and lowering a **measuring rod**.

To install:

1. Drill holes at the selected height.
2. Secure the **height adjustment comb** using the **comb mounting kit**.

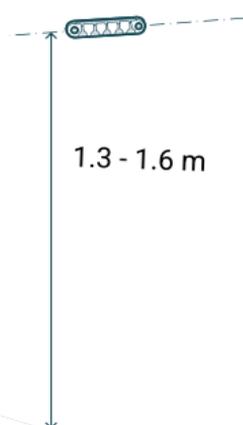

- 4
1. Separate the cords from the roll according to the number of **measuring rods**.
 2. Insert one end of the **pre-cut cord** through the smaller hole of the **fixation cap** on one side of the **measuring rod** and tie a large knot so that it stops in the larger hole.
 3. Thread the other end of the **cord** through the **roller bracket**, lower it to the opposite end of the **measuring rod**, and secure it in the same way.
 4. Fold the **cord** in half between the fixation points and thread it through the second **roller bracket**.
 5. Thread the folded **cord** through the **fixation caps**, lift the **measuring rod** to the ceiling, and secure the first height level. The second height level is set lower at a comfortable user height.

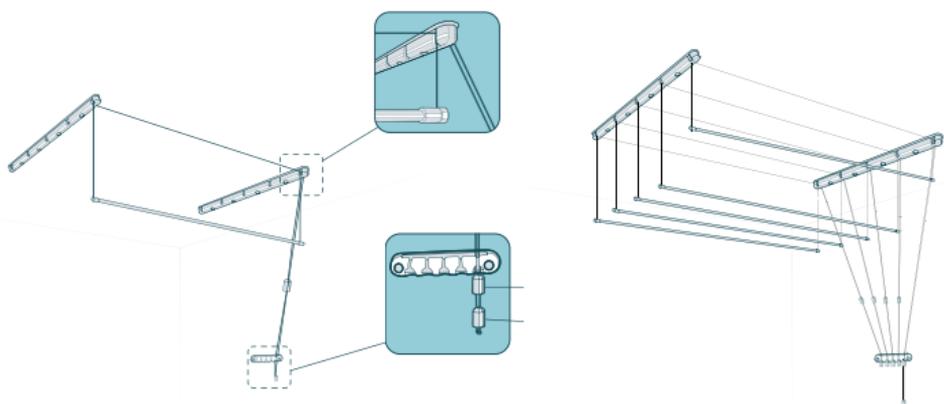

- 5 Before use, wipe the **measuring rods** with a damp cloth.

Video Instructions



Made in Ukraine (UA)

ffgroup.online

alexvalex.online